


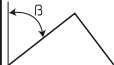


TABLEAU DE CHARGE POUR ÉLINGUE EN CHAÎNE GRADE 80 ET QUALITÉ VIP

QUALITÉ Gr 80	1 BRIN	2 BRINS		3 ET 4 BRINS		ENTOURAGE				ÉTRANGLEMENT			QUALITÉ VIP
						SIMPLE		DOUBLE		SIMPLE	DOUBLE		
angle β	0°	0-45°	45-60°	0-45°	45-60°	0-45°	45-60°	0-45°	45-60°	0°	0-45°	45-60°	angle β
Facteur de charge	1	1.4	1.0	2.1	1.5	1.1	0.8	1.7	1.2	0.8	1.1	0.8	Facteur de charge
\varnothing chaîne	CMU/TONNE												\varnothing chaîne
	0.5	0.7	0.5	1.05	0.75	0.55	0.40	0.85	0.60	0.40	0.55	0.40	◀ 4
6 ▶	1.12	1.60	1.12	2.36	1.70	1.23	0.89	1.90	1.34	0.90	1.23	0.90	
	1.50	2.10	1.50	3.15	2.25	1.65	1.20	2.55	1.80	1.20	1.65	1.20	◀ 6
7 ▶	1.5	2.10	1.5	3.15	2.25	1.65	1.20	2.55	1.80	1.20	1.65	1.20	
8 ▶	2.0	2.80	2.0	4.25	3.00	2.20	1.60	3.40	2.40	1.60	2.20	1.60	
	2.50	3.50	2.50	5.25	3.75	2.75	2.00	4.25	3.00	2.00	2.75	2.00	◀ 8
10 ▶	3.15	4.25	3.15	6.70	4.75	3.46	2.52	5.35	3.78	2.52	3.46	2.52	
	4.00	5.60	4.00	8.40	6.00	4.40	3.20	6.80	4.80	3.20	4.40	3.20	◀ 10
13 ▶	5.30	7.50	5.30	11.20	8.00	5.83	4.24	9.00	6.36	4.24	5.83	4.24	
	6.50	9.10	6.50	13.65	9.75	7.15	5.20	11.00	7.80	5.20	7.15	5.20	◀ 13
16 ▶	8.00	11.20	8.00	16.80	12.00	8.80	6.40	13.60	9.60	6.40	8.80	6.40	
	10.00	14.00	10.00	21.00	15.00	11.00	8.00	17.00	12.00	8.00	11.00	8.00	◀ 16
18 ▶	10.00	14.00	10.00	21.00	15.00	11.00	8.00	17.00	12.00	8.00	11.00	8.00	
20 ▶	11.20	15.68	11.20	23.52	16.80	12.32	8.96	19.04	13.44	8.96	12.32	8.96	
22 ▶	15.00	21.00	15.00	31.50	22.50	16.50	12.00	25.50	18.00	12.00	16.50	12.00	
	20.00	28.00	20.00	42.00	30.00	22.00	16.00	34.00	24.00	16.00	22.00	16.00	◀ 22
26 ▶	21.20	29.68	21.20	44.52	31.80	23.32	16.96	36.04	25.44	16.96	23.32	19.96	
32 ▶	31.50	44.10	31.50	66.15	47.25	34.65	25.20	53.55	37.80	25.20	34.65	25.20	
EN CAS DE CHARGE ASYMÉTRIQUE, IL FAUT MODIFIER LES FACTEUR DE CHARGE COMME SUIT													
	1	1	1	1.5	1	0.8	0.8	0.8	0.8	0.8	0.8	0.8	